



Technical Service Bulletin

TB4	Affected Models:	Pontiac Fiero 1984-1988			
	Kit Numbers:	K0059-01	K1914-01	K1915-01	K1915-03
	Problem:	High Clutch Pedal Effort, Release System Failure. Clutch will not release.			
	Solution:	Release system inspection			
	Ref. Bulletin:	GM Number 87-7-55 September 1988			

In order to correctly service these applications it is required to inspect the release system as outlined in the GM bulletin. The bulletin covers clutch wear and noise and refers to four specific areas to inspect.

1. Clutch pedal and pedal standoff bracket: Inspect for pedal deflection or bent components.
2. Clutch release fork: Inspect for cracked, bent, or deflecting release fork. Replacement with cast iron release fork is recommended.
3. Pedal and pedal return stop: Inspect for interference prohibiting complete pedal travel.
4. Hydraulic system: Inspect to be certain the system is completely bled of air.

Please refer to the GM bulletin for complete details.