



Technical Service Bulletin

TB12 **Affected Models:** Chevrolet L-Body (Corsica, Beretta) 1988-90

Problem: Low Clutch Engagement and/or Difficulty in Starting Engine

Solution: Floor Carpet / Sound Barrier Modification

Ref. Bulletin: GM Number 90-226-6A, April 1990

Low clutch engagement or excessive pedal effort for engine start may be conditions experienced in the L body vehicles. These conditions may be a result of the clutch pedal or driver's foot contacting the carpet while disengaging the clutch. To repair, trim away the sound barrier material underneath the carpet/pedal interference point until the carpet conforms to the contour of the floor pan.