



Technical Service Bulletin

TB13 **Affected Models:** Hyundai Excel 1986-94

Problem: Bent or Broken Clutch Fork Roll Pins

Solution: Replacement

Hyundai Excels use roll pins to connect the clutch fork to the cross shaft. These pins commonly bend or break which results in improper clutch engagement or complete clutch failure. It is advised to replace the roll pins with every clutch installation. 1986-1989 use Hyundai # 14311-06225, 1990-1992 use Hyundai # 14311-08255.

SACHS NORTH AMERICA 909 Crocker Road Westlake, OH 44145
Technical Hotline 1-800-321-0784, Ext. 110
8:00 AM - 5:00 PM EST