



## Technical Service Bulletin

---

<b>TB19</b>	<b>Affected Models:</b>	1994 Jeep Cherokee & Wrangler
	<b>Problem:</b>	Premature Clutch Slippage and Reduced Wear Capacity
	<b>Solution:</b>	Repair Shim Installation
	<b>Ref. Bulletin:</b>	Jeep #06-03-94

All manual transmission equipped 1994 Cherokees and Wrangler may experience clutch slippage once the clutch is 2/3 worn. This may be due to insufficient clearance between the clutch housing and the slave cylinder. To resolve this condition, a special 5mm shim from Jeep (#4797072) is to be installed to provide additional travel for the clutch slave cylinder. The additional travel will allow complete engagement of the clutch and eliminate the previous partial-release condition.